Case Report

Perforation of Left Ventricular wall and Ipsilateral Pleura by a Right Ventricular Pacemaker lead: Case Report

Cristina Viscogliesi¹, Dario Buioni^{1*}, Paolo Nardi¹, Calogera Pisano¹, Eleonora Latini¹, Federico Agneni¹, Claudia Altieri², Giovanni Ruvolo¹

¹Cardiac Surgery Division, Tor Vergata University Hospital, Rome, PC 00133, Italy.

²Cardiology Unit of the Cardiac Surgery Division, Tor Vergata University Hospital, Rome, PC 00133, Italy.

*Corresponding Author: Dario Buioni, Cardiac Surgery Division, Tor Vergata University Hospital, Viale Oxford 81, Rome, PC 00133, Italy.

Received Date: February 12, 2024 | Accepted Date: March 27, 2024 | Published Date: April 11, 2024

Citation: Cristina Viscogliesi, Dario Buioni, Paolo Nardi, Calogera Pisano, Eleonora Latini et al., (2024), Perforation of Left Ventricular wall and Ipsilateral Pleura by a Right Ventricular Pacemaker lead: Case Report, *International Journal of Clinical Case Reports and Reviews*, 17(1); **DOI:10.31579/2690-4861/418**

Copyright: © 2024, Huai-li Luo. This is an open-access article distributed under the terms of the Creative Commons Attribution License, which permits unrestricted use, distribution, and reproduction in any medium, provided the original author and source are credited.

Abstract:

Introduction: Malposition of pacemaker lead is uncommon event and it usually regard the right ventricle. In rare cases, the perforation can involve the left ventricle and this is a potentially life-threatening complication.

Case presentation: We described a case of both septum and LV free wall perforation by an RV pacemaker lead in an 84year-old woman. Perforation also resulted in left pneumothorax and she became symptomatic. She also had pericardial effusion, so she underwent cardiac surgery to repair the bleeding lesion. As the swab for Covid-Sars 2 was positive, we had to wait for the negativization for the replacement of the ventricular lead.

Conclusions: early identification is mandatory to prevent this complication and transvenous lead extraction with cardiac surgery backup should be considered.

Keywords: pacemaker; right ventricular pacemaker lead; lead migration; left ventricular perforation; transvenous lead extraction; pneumothorax; pericardial effusion

Introduction

Published event rates of pacemaker lead perforation range from 0,1 to 0,8%. It includes acute, subacute and late perforation but subclinical lead perforation occurs more frequently. [1] Cardiac perforation is uncommon complication of transvenous pacemaker implantation and it usually regard the right ventricular apex due to the thin wall [2] Malposition in the left ventricular is an uncommon event and its incidence could be underestimated because the patient remains asymptomatic. The diagnosis can derive from the 12-lead ECG, the chest radiographs and from the computed tomography (CT). CT scan is considered the gold standard for evaluating for perforation [3]. It is used to confirm pericardial or pleural effusion and lead position or displacement [2].

Case Presentation

An 84-year-old woman with a dual-chamber pacemaker implanted via the left cephalic vein for second degree atrioventricular block 2:1 (Mobitz 1). The day after the implantation, the chest x-ray showed dislocation of the

lead and it was implanted the same day. In the hours following the implantation, the patient complained chest pain modifiable with the acts of the breath. Chest CT scan documented share of left PNX predominantly anterior with a maximum thickness of about 15 mm and minimal pericardial effusion of 1 cm. The day after a CT scan was performed to check the pnx. The flap was greater and the CT showed the ventricular catheter beyond the wall of the ventricle for about 5 mm, close to the pericardium and the pulmonary pleura. She therefore performed PMK check which showed increased right ventricle lead impedance and unipolar capture; increased ventricular threshold in bipolar. Before the transfer to our cardiac surgery room, the patient tested positive for Sars-Cov 2.

During the intervention, after the sternotomy, an important quantity of frankly blood liquid was aspirated and the clot on the anterior wall of the ventricle was removed. The electrod-catheter was 5 mm out of the left ventricle, about half a centimeter from the course of the anterior

Clinical Case Reports and Reviews.

Copy rights @ Huai-li Luo, et al

descending artery. Repair was carried out with a U point in polypropylene 4-0 reinforced with double pledgets and application of pericardium patches with Coseal glue and Tabotamp. The left pleura was opened to drain the pnx.

After surgery, she underwent cardiac CT (Figure. 1) which showed the tip of the ventricular lead projecting outwardly passing the antero-septal wall at the apical level and coming into close contact with the parietal pericardium at that level.

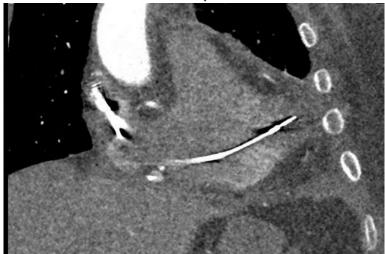


Figure 1: Therefore, after 20 days from the first, she was subjected to an operation of PMK repositioning under general anesthesia with transesophageal ultrasound monitoring.

Discussion

Cardiac pacemaker devices are used for cardiac conduction abnormalities and arrhythmias. The complication derived from them, can be divided into three categories: acute within 24 hours, subacute if within one month, chronic after one month. The most common complication included pneumothorax, lead malposition and myocardial perforation. [2]

Pacemaker lead perforation is often attributed to one or a combination of factors including patient characteristics, concomitant therapies such as steroids or anticoagulants, implant techniques and the designed characteristics of the lead.

Anyway, anatomic variations largely account for lead misplacement into LV during the implantation of a cardiac device. The most common route is the interatrial septum and PFO. Possible complication of malposition of the lead into the left ventricular wall is the formation of thrombi around the site of lead placement, with subsequent risk of systemic thromboembolic events (more than one-third of cases).

This event occurs when the diagnosis is delayed. The patients who remain asymptomatic may opt for anticoagulation with warfarin with targeting international normalized ratio between 2,5 and 3,5. If cerebral embolic events occur, catheter surgical extraction should be reconsidered. [4]

The therapeutic options for a misplaced lead are limited and they depend on the symptomatology of the patients, on the time elapsed from implantation and on the bleeding risk of the patient. Adequate lifelong anticoagulation with warfarin is the therapy of choice if the lead has been placed for a long time. Lead extraction should be reserved for failure of anticoagulation or during other concomitant cardiac surgery. [5] Otherwise, if misplacement is diagnosed early after implantation, that is less than one year, with or without any associated thromboembolic episode it should be percutaneously removed and repositioned. [6] In this report, we demonstrated that such a complication could become a life-threatening complication. The patient should undergo a sternotomy due to pericardial effusion complicated by cardiac tamponade.

As shown by the retrospective study on 26 patients made by Marius Schwerg et al., pericardial effusion and tamponade were present in 38% and 19%, respectively. [7] Therefore this complication si not so rare and in case of unclear results, thoracic CT scans are essential to determine if the pleural or LV free wall is implicated and to establish an appropriate diagnosis. [8]

The American Heart Association suggests that transvenous lead extraction is not the preferred strategy for patients with cardiac perforation due to pacing/defibrillation lead. [8] But our patent was symptomatic for pneumothorax and she had pericardial effusion, so we were forced to do a sternotomy. Once resolved the Sars-Cov 2 infection, we proceeded to lead extraction and replacement of the same catheter in a hybrid operating room, under careful hemodynamic and transesophageal echocardiographic monitoring with a cardiac surgical backup.

Conclusion

No specific recommendations are known to exist for this uncommon complication, but in this case, there were signs and symptoms that suggest the diagnosis. To assess whether the pleural or LV free wall is involved, x-Ray is not enough. CT scan is essential to not delay the diagnosis. This patient was hemodynamically instable and she hard to undergo a sternotomy. Maybe if the hospital where she implanted the pacemaker, had requested the CT scan first, we would have been able to arrange the hybrid operating room to proceed to lead extraction, avoiding the sternotomy, the delayed of replacement of PMK and one month of recovery.

Clinical Case Reports and Reviews.

References

- Carlson MD, Freedman RA, Levine PA. (2008). Lead perforation: incidence in registries. Pacing *Clin Electrophysiol* 31:13–15.
- Khalid M, Murtaza G, Ayub MT, Ramu V, Paul T. (2018). Right Ventricle Perforation Post Pacemaker Insertion Complicated with Cardiac Tamponade. *Cureus*. 4;10(3): e2266.
- Iribarne A, Sangha RS, Rostock IC, Rothstein ES, Mccullough JN. (2018). Right ventricular lead perforation through the septum, left ventricle, and pleura, managed by an open surgical approach. *HeartRhytm Case Rep* 4:397-400
- Rovera C, Golzio PG, Corgnati G, Conti V, Franco E, et al. (2019). A pacemaker lead in the left ventricle: An "unexpected" finding? *J Cardiol Cases*. 12;20(6):228-231.

- 5. Zaher et al. (2011). Inadvertent malposition of a permanent pacemaker ventricular lead into the left ventricle which was initially missed and diagnosed two years later: a case report. *Journal of Medical Case Reports* 5:54
- Singh N, Madan H, Arora YK, Dutta R, Sofat S, et al. (2013). Malplacement of endocardial pacemaker lead in the left ventricle. Med J Armed Forces India. 2014 Jan;70(1):76-78.
- Schwerg M, Stockburger M, Schulze C, Bondke H, Poller W, et al. (2014). Clinical, anatomical, and technical risk factors for postoperative pacemaker or defibrillator lead perforation with particular focus on myocardial thickness. Pacing *Clin Electrophysiol.* 37:1291–1296.
- 8. Huang X, Zhou H, Li X-M and Li X-L (2023). Case report: Left ventricular perforation caused by right ventricular pacemaker lead. Front. *Cardiovasc.* Med. 9:1089694.



This work is licensed under Creative Commons Attribution 4.0 License

Submit Manuscript

To Submit Your Article Click Here:

DOI:10.31579/2690-4861/397

Ready to submit your research? Choose Auctores and benefit from:

- ➢ fast, convenient online submission
- > rigorous peer review by experienced research in your field
- > rapid publication on acceptance
- > authors retain copyrights
- > unique DOI for all articles
- > immediate, unrestricted online access

At Auctores, research is always in progress.

Learn more <u>https://auctoresonline.org/journals/international-journal-of-</u> clinical-case-reports-and-reviews